

## BMT 932 / 932 C Replacement of Utility Scrubber

Rev. 1.1 - 05. Mar. 2026

This Service Note explains the process of replacing the utility scrubber, after Scrubber Warning has been displayed.

### Safety Instructions


- Disconnect the monitor from mains power
- Attach your anti-static wrist strap to ground, only – if this is not possible: at least eliminate any electrostatic charge by touching a grounded surface before opening the monitor

### Preparation for BMT 932 19" version (Start with step 3 for 932 C)

1. Open up the instrument's top panel with a Phillips Head screwdriver.




2. Unplug the grounding wire attached to the top panel.

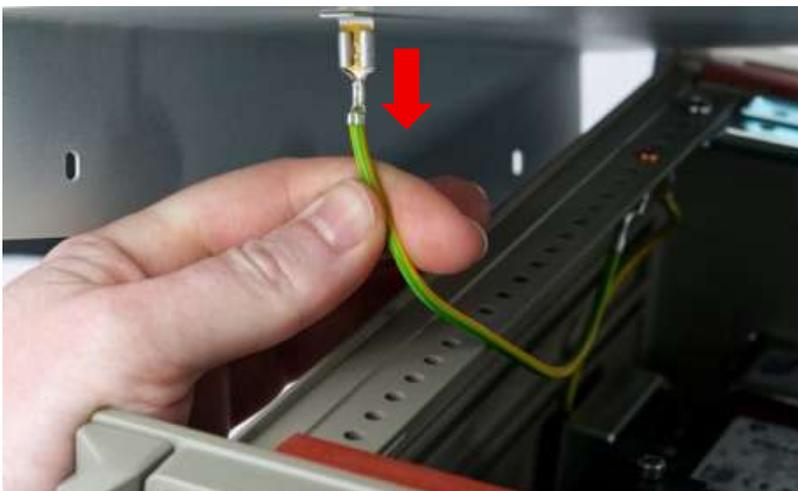

**Start from this point for BMT 932 C**


3. The black tubing from the utility scrubber has to be removed. Do not pull off the tubing by hand as it could tear.

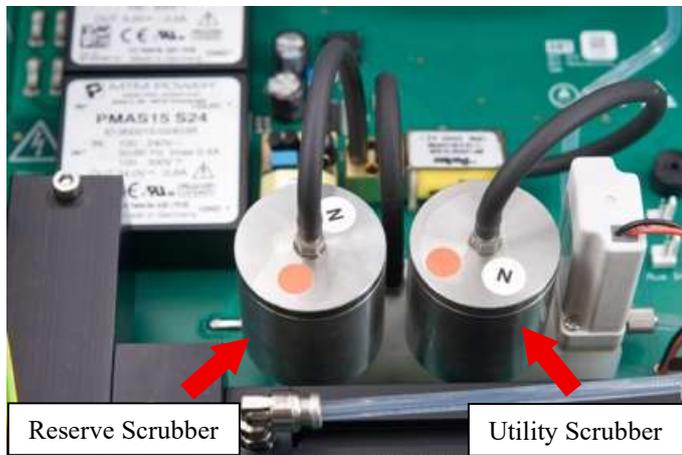

4. Use a flat screwdriver to push the tubing off.



5. Remove the scrubber by turning it counterclockwise.

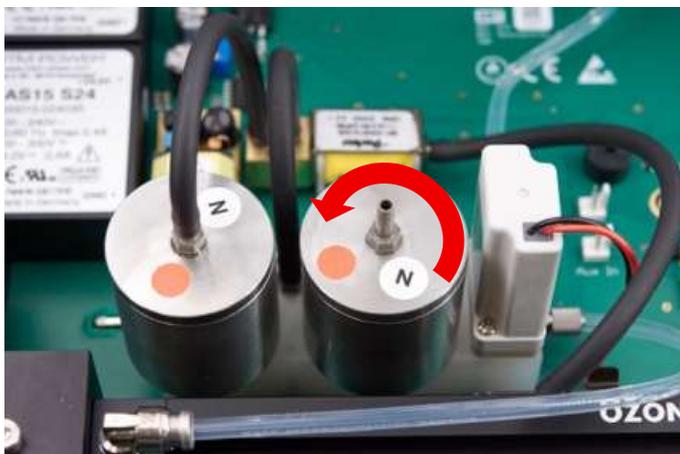

6. Screw in the new scrubber to the exposed thread. Make sure that the green O-ring is seated correctly.



7. Push the black Viton tubing on the grey nipple on top of the utility scrubber.
8. Repeat the steps in reverse order, to put the instrument back together.
9. **Do not forget to reattach the grounding wire to the monitor's top panel.**

If any problems occur, do not hesitate to contact us:

BMT Messtechnik GmbH, Hamburger Str. 19, D-14532 Stahnsdorf, Germany  
Tel.: +49-3329-696 77-0  
service@bmt-berlin.de

Your BMT Service Team